

CASE STUDIES

กรณีศึกษา 1: สเตเตอร์หลวม (Stator Looseness)

กรณีศึกษา 1: สเตเตอร์หลวม (Stator Looseness)



ระยอง : ประเทศไทย

ข้อมูลเบื้องต้น :



มอเตอร์ไฟฟ้าอายุ มากกว่า 15 ปี ส่ง overhaul ตามรอบ เก็บสำรองในสโตร์ 1 ปี หลังจากติดตั้ง มีอาการเสียงดัง และค่าความสั่นสะเทือน สูง

แนวทางการตรวจสอบ:

ทำการขอข้อมูลเพิ่มเติม ในส่วนค่า Vibration Spectrum จำนวน Rotor bar และ stator slot ไม่ตรงกับ fault frequency ที่ตรวจพบ

การค้นหาคาเหตุ:

เนื่องจากผล Vibration Spectrum ทำให้ต้องตรวจ Magnetic Circuit เพิ่มเติม ตรวจพบความไม่สมดุลของสนามแม่เหล็ก แต่เช็คไม่พบความผิดปกติที่ขดลวด จึงแนะนำถอดเพื่อเช็ค Stator laminate พบมีจุดหลวมหลายจุด จึงแจ้งลูกค้าเพื่อดำเนินการแก้ไข

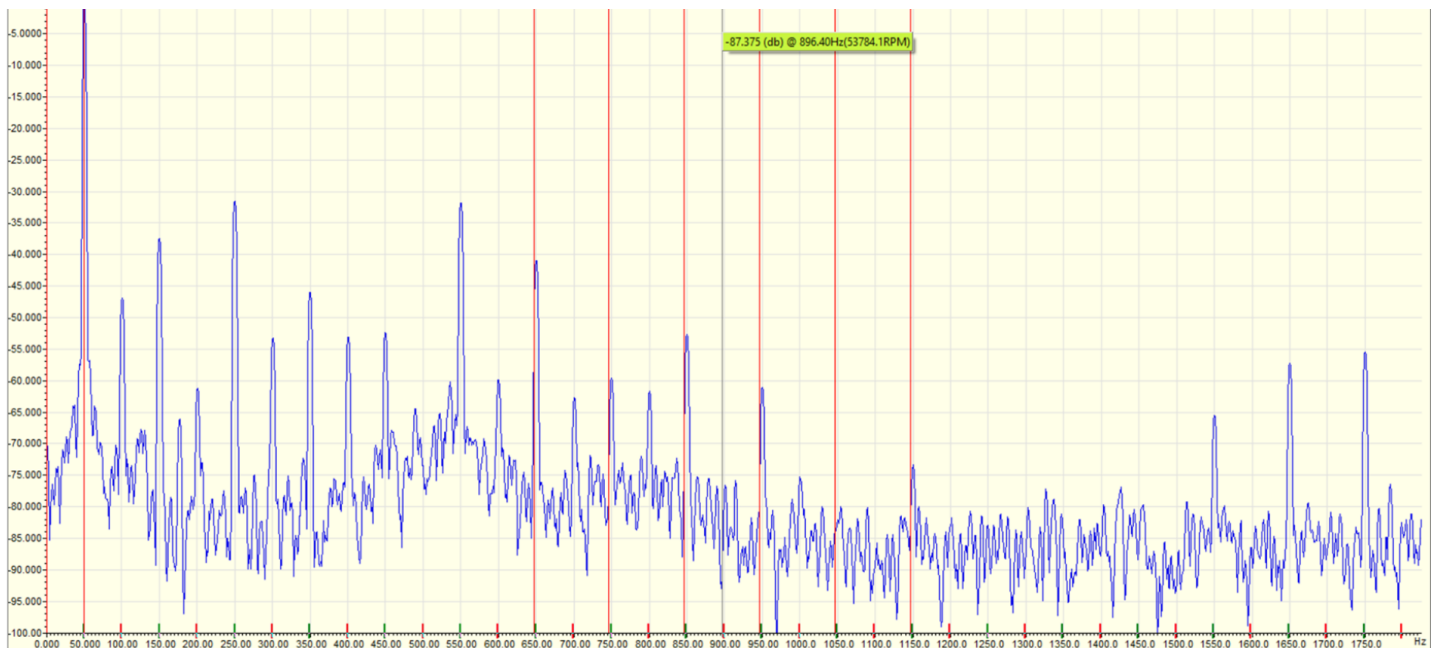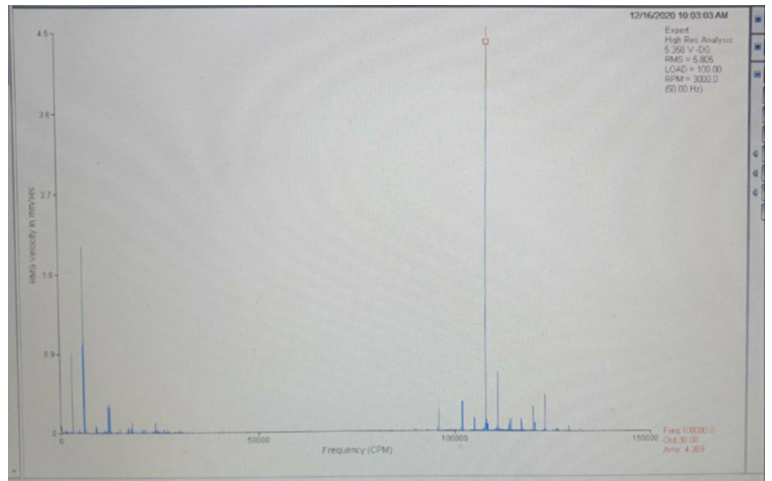

20201224-08:17:13

		32	21	13
Resistance (Ohm)	OK	0.763	0.758	0.759
Impedance (Ohm)		36.6	36.8	37.1
Inductance (mH)		58.4	58.5	59.0
Phase Angle (°)	OK	85.2	85.2	85.3
I / F (%)	OK	-48.7	-48.7	-48.7
Stator	WARN			
Rotor				
Insulation (MOhm)	OK	>5000		
			TVS	110
			Ref Value	
Contamination(%)	OK	1.40%		
Capacitance (µF)		91.2		
Frequency				100

Findings: Possible stator winding issue
Insulation Test Voltage: 1,000V
Instrument: AT701361
Calibration: 20201019-16:16

The stator signature phase 3-2 lines is significantly higher than the other two signatures

This means the problems are with the stator windings, Possible case of The stator looseness

32

21


13

Stator Signature: Solid green line

Rotor Signature: Curves connecting dots

%: Change in impedance during rotation


Sdev (%): Deviation of the stator signature

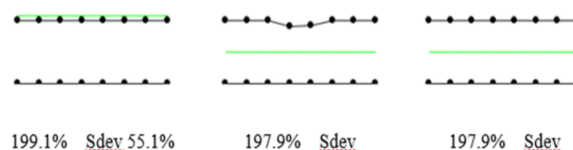

Dynamic Signature Analysis

The Green line is the Stator signature and represents the deviation of the mean values during rotation for each phase. The two black dotted lines represent the Rotor Signature and include an upper and lower signature.

Case Study 1: Stator Looseness

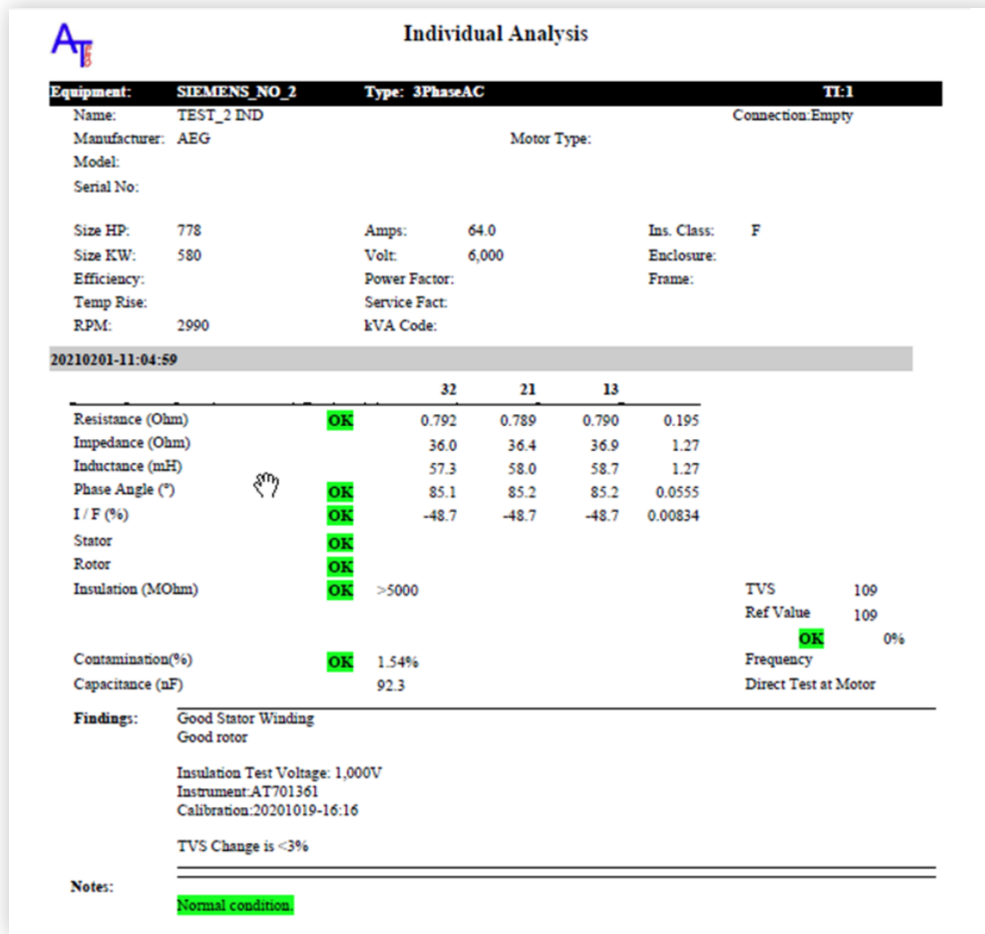

After overhaul test result.

